

PART NO. 10659-C

ITEM NO.	PART NUMBER	DESCRIPTION	QTY.	MULTI-PAK
1	814383	CASE-HOUSING-HANDLE ASSEMBLY; EXACTA II 250	1	
2	21657	EXACTA 2 - 3 CPU PCB	1	
3	30488	#3 PLASTIC WASHER	4	816162(4)-10*
4	30489	SCREW 2.5mm X 0.45mm X 12mm SELF TAPPING	4	816161(4)-10*
5	30501	Nylon Retaining Spacer 0.115 x .25 x 0.1875	4	816163(4)-10*
6	21407	BEZEL LCD EXACTA II	1	
7	21741	3.6V BATTERY PACK HOLDER ASSEMBLY	1	
8	21745	3.6V BATTERY PACK CAP ASSEMBLY	1	
9	21426	COVER FOR RS232-SWITCH; EXACTA II	1	
10	30496	Alloy Steel FHSCS 6-32 x 5/16 , 91253A145	2	
11	813856	BEARING PIN FRONT EXACTA	2	816249(2)-5*
12	812122	RING, RADIAL FITTING	2	816897(2)-10*
13	21658	SWITCH PANEL, EXACTA 2, 1250 SERIES	1	
14	21427	GASKET TAPE	2	
15	842980	BALL: 3/32" DIA.	8	816886(8)-10*
16	812171	SPRING-BELLEVILLE: CAL-36 TORQ. WR.	2	86878(2)-20*
17	21636	1250 SERIES X-BEE RADIO - HOUSING COVER ASSEMBLY	1	
18	21506	TRANSDUCER-ASSY 250 FT.LB (DOVETAIL) EXACTA II	1	
19	21736	FCC LABEL FOR XBEE RADIO	1	
20	21685	CABLE, 1.00MM CENTER FFC JUMPER, 3" LONG	1	
21	21686	CABLE ASSY, VIBRATION MOTOR, EXACTA II 1250	1	

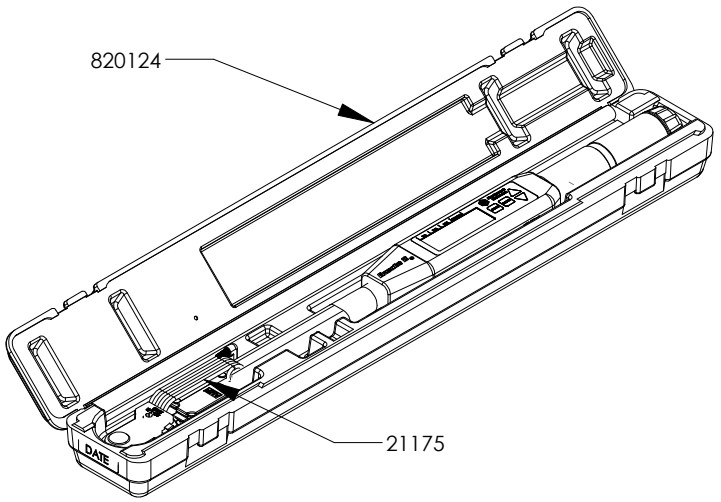

LEGEND: ( ) = QUANTITY/TOOOL
* = QUANTITY/MULTI-PAK

NOTES:
1. CUT A MINIMUM HOLE IN PARTS 21427 FOR WIRES TO COME THRU.
2. PRIOR TO INSERTING THE BATTERY PACK HOLDER ASSEMBLY (21741), APPLY A BEAD OF ADHESIVE SEALANT (MOMENTIVE RTV 103) APPROXIMATELY 1/3 OF THE WAY AROUND THE INNER CIRCUMFERENCE AND A MINIMUM OF 1/2" BELOW THE THREAD LINE OF THE HANDLE.
3. GLUE PART 21426 USING 3M SUPER STRENGTH ADHESIVE P/N 6004.
4. ATTACH VIBRATION MOTOR (21686) TO SIDE OF CASE.

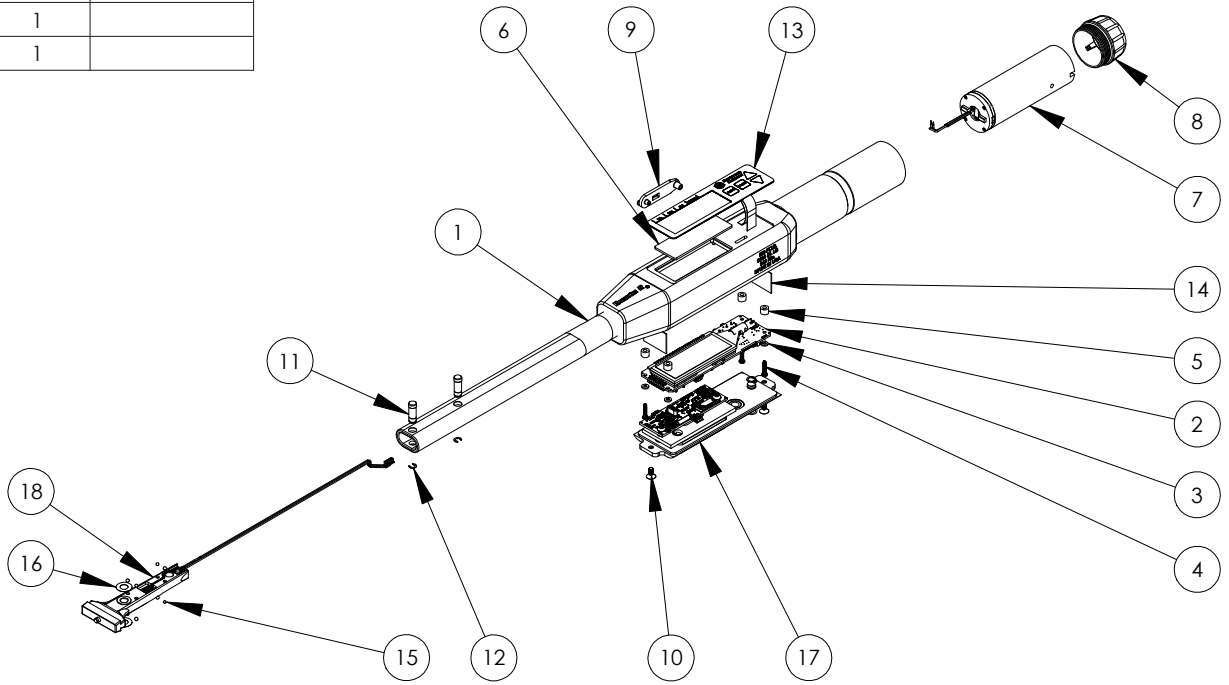

THIS PRINT AND ALL INFORMATION APPEARING THEREON IS THE PROPERTY OF "STURTEVANT RICHMONT". NEITHER THE PRINT NOR THE INFORMATION THEREON MAY BE REPRODUCED OR USED IN ANY MANNER WHATSOEVER OR DIVULGED TO ANY OTHER PERSON UNLESS SPECIFICALLY AUTHORIZED BY "STURTEVANT RICHMONT".

DESCRIPTION	DIAGRAM No	REV.
EXACTA II 1250 SERIES 250, DOVETAIL	10659-C	C